
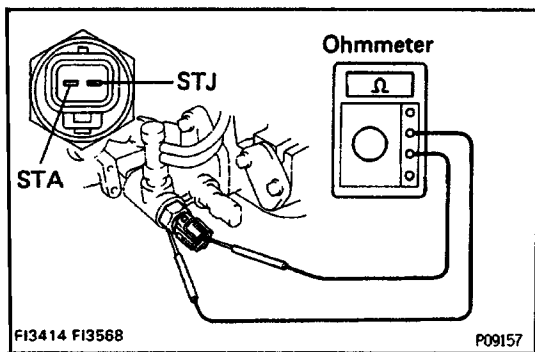


COLD START INJECTOR TIME SWITCH

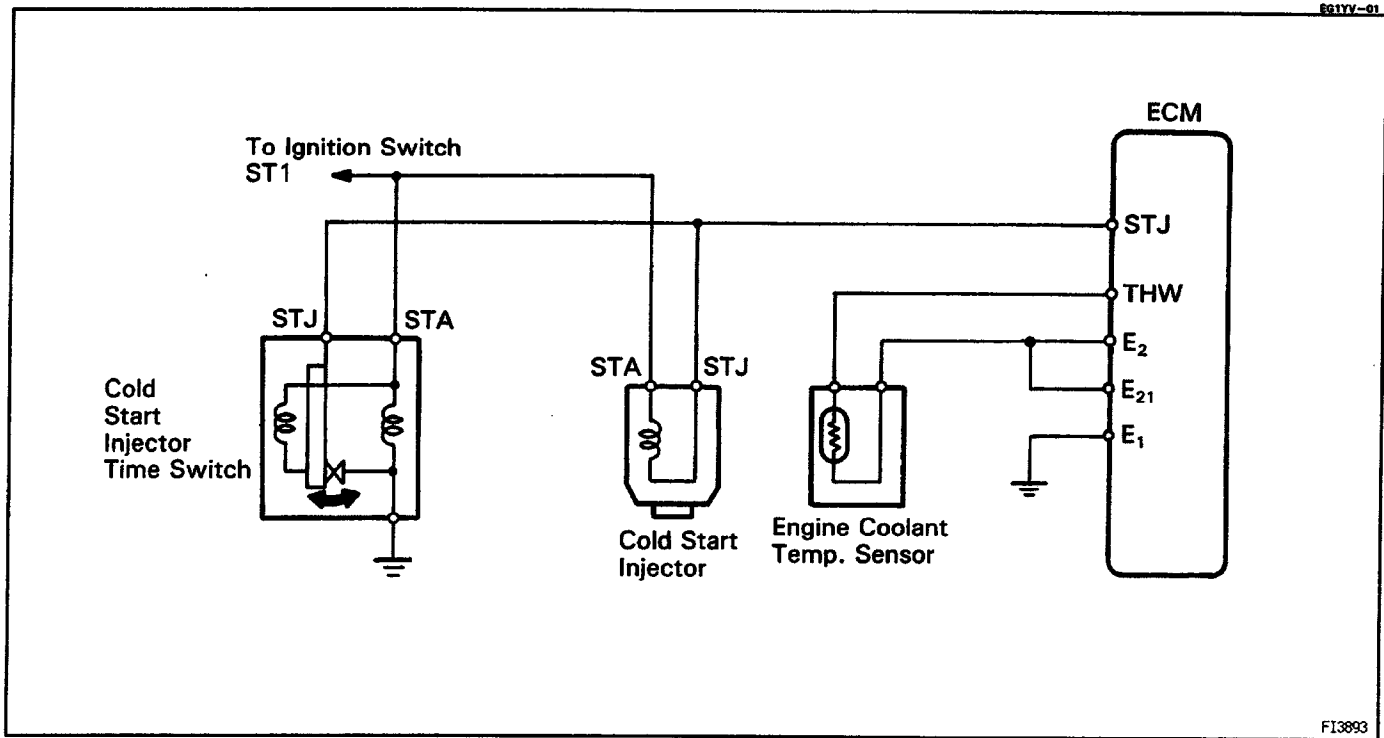

START INJECTOR TIME SWITCH INSPECTION

MEASURE RESISTANCE OF START INJECTOR TIME SWITCH

- Disconnect the connector.
- Using an ohmmeter, measure the resistance between terminals.

Between terminals	Resistance (Ω)	Coolant temperature
STA - STJ	30 - 50	below 10°C (50°F)
	65 - 90	above 30°C (86°F)
STA - Ground	30 - 90	—